Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)2) 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



# **Harness Structural test Report - NfL**

Inspection certificate number: PH\_353.2022

Manufacturer data:

Manufacturer name:

Representative:

Woody Valley srl Simone Caldana

Street: Via Linz 23

Post code place: 38121 Trento

Country: Italy

Name: Type:

Sample data:

Exense ABS

Size: L

Serial number: **044 0115 2015\_S** 

Impact pad type: (1) **Foam** Clip-in weight [kg]: **120** 

Integrated

container: Yes

Date of test: **03.02.2022** 

Atmosphere AGL:

[C°]	20	
RH [%]	31	
[hPa]	1012	

#### **Summary of Structural test**

Test id	-	Ref.	Setup	Req. Load [g]	Req. Load [N]	Min. duration [s]	Result
02	٧	5.3.2.1	Default flying position	6	7200	10	POSITIVE
03	٧	5.3.2.2	Default flying position	15	18000	5	POSITIVE
04	٧	5.3.2.3	Asymmetric, one riser	6	7200	10	POSITIVE
07	٧	5.3.2.6	Asymmetric, negative	4.5	5400	10	POSITIVE
09	٧	5.3.2.4	Rescue attachments	15	18000	5	POSITIVE
13	٧	5.3.2.7	Flying position before landing	15	18000	5	POSITIVE
14		5.3.2.5	Towing	5	6000	10	n/a

#### Rescue deployment test

Test id - NfL 2-565-20	Setup	Min load [N]	Max. load [N]	Measured [N]	Result
RRDT V 6.1.5	Default flying position	20	70	68.54	POSITIVE

#### **Rescue Deployment Handle strength test**

Test id	-	EN 12491	Setup	Req. Load [N]	Min. duration [s]	Breaking strength [N]	Result
RRST	٧	5.3.2	Two end points of handle	700	10	1575.46	POSITIVE

#### Rescue deployment test with integrated container for rescue system

Test id	- NfL 2-565-20	Setup	Result
RDIC	4.3.2-4.3.6	Release of the container at maximum volume	n/a

Manufacturer	Instrument	Type no	S/N	Validity
HBM	Load Sensor GE01	1-S9M/50KN-1	31314643	04.09.2023
Burster / MTS	Load sensor 10kN SL2	8431-6010-N000S000	593507	21.04.2026
JDC elec	Geos n°11 Skywatch	Geos n°11	Unit11	18.06.2025

Air Turquoise SA, having thoroughly assessed the sample mentioned above, declares it was found conform with

Airworthiness Requirements NfL 2-565-20 - EN12491:2015 5.3.2

 $The \ validation \ of \ this \ test \ report \ is \ given \ by \ the \ signature \ of \ the \ test \ manager \ on \ the \ Inspection \ Certificate \ no \ 94.20$ 

<sup>(1)</sup> If Impact pad available, see test report no. 94.22 and inspection certificate no. 94.20

Calculated values in tests reports include the value minus the uncertainty (on safe side) / The uncertainty stated is the expanded uncertainty obtained by multiplying the standard uncertainty by the coverage factor k = 2. The value of the measurand lies within the assigned range of values with a probability of 95%.


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH\_353.2022 model: Exense

<b>Harness Structural test</b>		Test ID 02
Standard	NfL 2-565-20	
Reference	5.3.2.1	
Test setup	Default flying position	
Attachment points	Both main riser attachment (3,4)	
Anchor points	Dummy (B1, B2)	
Required load [g]	6	
Required load [N]	7200	
Minimum test duration [s]	10	
Result		
Test duration [s]	13.3	F/2 A F/2
Any signs of structural failure	No	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
Test results	POSITIVE	\3   4/
		)
		B1 B2
		F/2 V F/2

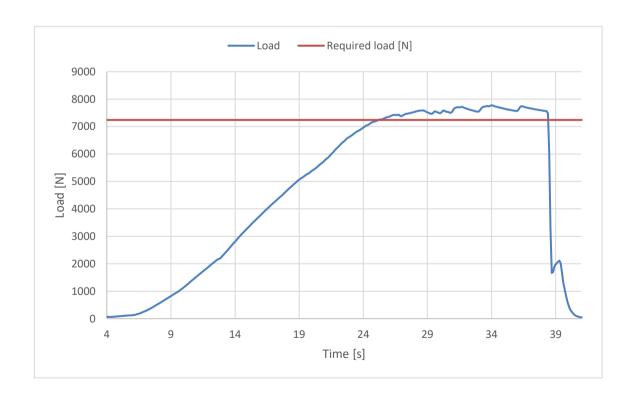


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH\_353.2022 model: Exense

Harness Structural test		Test ID 03
Standard	NfL 2-565-20	
Reference	5.3.2.2	
Test setup	Default flying position	
Attachment points	Both main riser attachment (3,4)	
Anchor points	Dummy (B1, B2)	
Required load [g]	15	
Required load [N]	18000	
Minimum test duration [s]	5	
Result		
Test duration [s]	6.7	F/2 A A F/2
Any signs of structural failure	No	
Test results	POSITIVE	\3   4/
		)
		B1   B2
		F/2 ▼

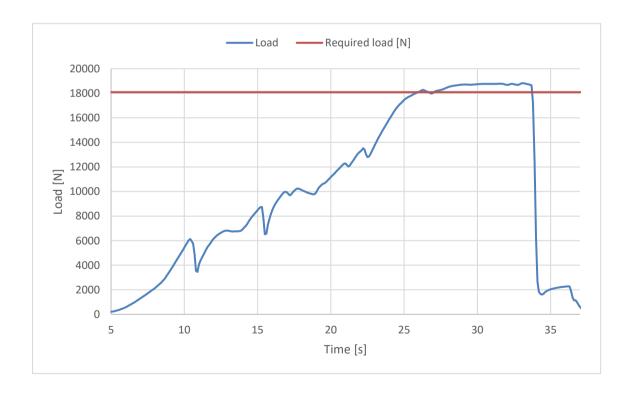


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH\_353.2022 model: Exense

Harness Structural test		Test ID 04
Standard	NfL 2-565-20	
Reference	5.3.2.3	
Test setup	Asymmetric, one riser	
Attachment points	One main riser attachment (3)	
Anchor points	Dummy (B1,B2)	
Required load [g]	6	•
Required load [N]	7200	
Minimum test duration [s]	10	
Result		<b>∫</b> <sup>F</sup> /
Test duration [s]	12.8	B1 3
Any signs of structural failure	No	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
Test results	POSITIVE	( )/_ (
		B2
		¥c
		<b>↓</b> F

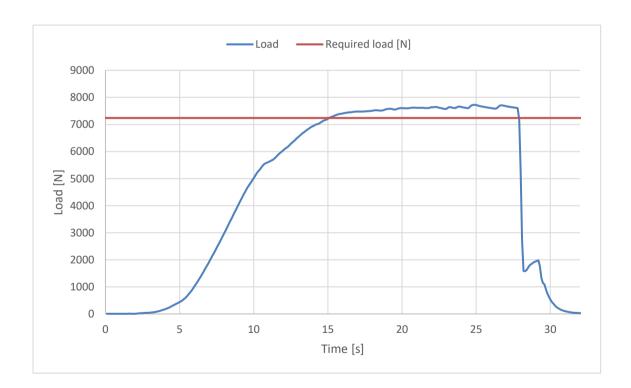


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH\_353.2022 model: Exense

Harness Structural test		Test ID 07
Standard	NfL 2-565-20	
Reference	5.3.2.6	
Test setup	Asymmetric, negative	/e
Attachment points	One main riser attac	chment (3 or 4) downwards
Anchor points	Dummy (9)	
Required load [g]	4.5	$\downarrow^r$
Required load [N]	5400	9
Minimum test duration [s]	10	
Result		) /
Test duration [s]	12.9	
Any signs of structural failure	No	3/4
Test results	POSITIVE	
		_ /
		$\bigcup_{F}$

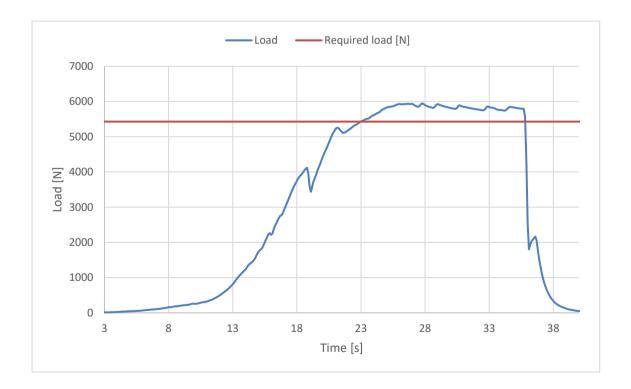


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH\_353.2022 model: Exense

<b>Harness Structural test</b>		Test ID (	09
Standard	NfL 2-565-20		
Reference	5.3.2.4		
Test setup	Rescue attachments		
Attachment points	Rescue riser attachment (1,2)		
Anchor points	Dummy (B1,B2)		
Required load [g]	15	F/2 <b>♦ ♦</b> F/2	
Required load [N]	18000		
Minimum test duration [s]	5		
Result Test duration [s] Any signs of structural failure Test results	11.7 No POSITIVE	B1 B2	- /2

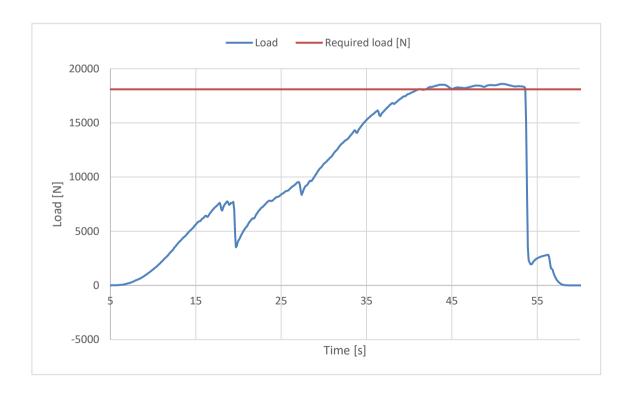


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH\_353.2022 model: Exense

<b>Harness Structural test</b>		Test ID 13
Standard	NfL 2-565-20	
Reference	5.3.2.7	
Test setup	Flying position before landing	
Attachment points	Both main riser attachment (3,4)	
Anchor points	Dummy (7,8)	
Required load [g]	15	
Required load [N]	18000	
Minimum test duration [s]	5	
Result		F. (+)
Test duration [s]	7.2	- H
Any signs of structural failure	No	3/44
Test results	POSITIVE	/
		10
		7/8 <sub>F</sub> 11

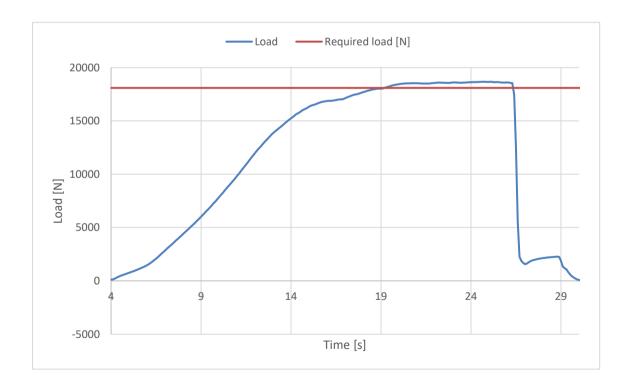

Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



**Test ID RRDT** 

Inspection certificate number: PH\_353.2022 model: Exense

Rescue Deployment Test

Standard NfL 2-565-20

Reference 6.1.5

Test setup Default flying position


Attachment points Sensor connect to handle, and pull in opening direction

The test is to simulate the load required to open the emergency parachute(1st action).

Min. Required load [N] 20
Max. Required load [N] 70

Result

Load for first action [N] 68.54
Test results POSITIVE

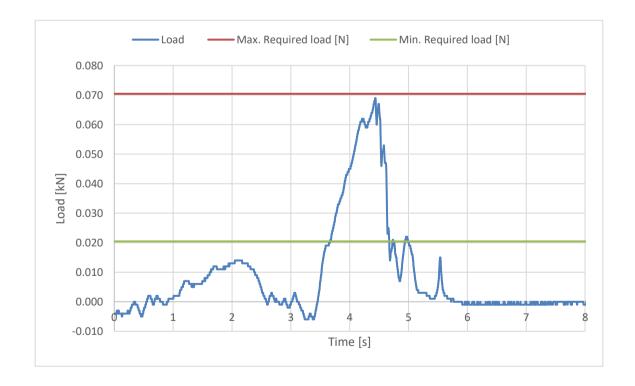

Route du Pré-au-Comte 8 ▲ CH-1844 Villeneuve ▲ +41 (0)2) 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH\_353.2022 model: Exense

**Rescue Deployment Handle strength test** 

**Test ID RRST** 

Standard **EN12491:2015** 

Reference in standard 5.3.2

Test setup Two end points of handle

Attachment points Sensor connect to end of handle, pull on the other side

The handle must support min 700 N for 10 s, after measure breaking strength

Min. Required load [N] 700
Minimum test duration [s] 10

Result

Test duration [s]: 17.1
Breaking strength [N] 1575.46
Test results POSITIVE

