Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)2) 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Harness Structural test Report - EN

Inspection certificate number: PH_294.2020

Manufacturer data: Sample data:

Ozone Gliders LTD Submarine Manufacturer name: Name: Russell Ogden **ABS** Representative: Type: 16 Barnes Green М Street: Size: **EH54 8PP Livingston** X-49C-068 Post code place: Serial number:

Country: Scotland UK Impact pad type: (1) Koroyd

Clip-in weight [kg]: 130

Date of test: **26.01.2023**

Atmosphere AGL:

[C°]	20
RH [%]	31
[hPa]	1007

Summary of Structural test

				Req. Load			
Test id	-	EN 1651	Setup	[g]	Req. Load [N]	Min. duration [s]	Result
01 (3)	٧	5.5.1.1	Positive symmetric load (Slippage)	4.5	5850	5	POSITIVE
03 (3)	٧	5.5.1.1b	Positive symmetric load	15	19500	5	POSITIVE
05	٧	5.5.1.2	Positive asymmetric load	6	7800	5	POSITIVE
06	٧	5.5.1.6	Negative symmetric load	6	7800	5	POSITIVE
08 (5)		5.5.1.9	Anti falling-out system	4.5	5850	5	n/a
09 (3)(4)	٧	5.5.1.3	Positive symmetric load rescue points	15	19500	5	POSITIVE
10 (3)(4)		5.5.1.4	Negative symmetric load rescue points	15	19500	5	n/a
11		5.5.1.8	Connecting element for rescue	n/a	24000	0.3	n/a
12 ⁽³⁾	٧	5.5.1.7	Upright (landing) position load	6	7800	5	POSITIVE
14		5.5.1.5	Negative symmetric load towing points	5	6500	5	n/a

Rescue deployment test

		Min load			
Test id - NfL II 91/09	Setup	[N]	Max. load [N]	Measured [N]	Result
RRDT V 6.1.5	Default flying position	20	70	44.73	POSITIVE

Rescue Deployment Handle strength test

Test id	-	EN 12491	Setup	Req. Load	Min. duration [s]	Breaking strength [N]	Result
RRST	٧	5.3.2	Two end points of handle	700	10	2776.22	POSITIVE

Manufacture	Instrument	Type no S/N	Validity Calibration
HBM	Load Sensor GE01	1-S9M/50KN- ⁻ 31314643	04.09.2023
Burster	Sensor Burster	8431-10000 1185483	04.09.2023
JDC elec	Geos n°11 Skywatch	Geos n°11 22	08.05.2020

Air Turquoise SA, having thoroughly assessed the sample mentioned above, declare it was found conform with European Standard EN1651:2018, and EN12491:2015

The validation of this test report is given by the signature of the test manager on the Inspection Certificate no 94.20

Calculated value in tests reports include the value minus the uncertainty (on safe side) / The uncertainty stated is the expanded uncertainty obtained by multiplying the standard uncertainty by the coverage factor k = 2. The value of the measurand lies within the assigned range of values with a probability of 95%.

This declaration must not be reproduced in part without the written permission of AIR TURQUOISE SA.

⁽¹⁾ If Impact pad available, see test report no. 94.22 and inspection certificate no. 94.20. (3) Slipping test of any adjustable components: No slippage of any adjustable element more than 10 mm at 4500N for 5 s. The marks should be added with a pre-load of 1000N. (4) For harness with integrated Y bridle, test in the end loop (5) Attach to anti-falling out system without connecting the crotch straps (breast straps)


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH_294.2020 model: Submarine

	Test ID 01
EN 1651	
5.5.1.1	
Positive symmetric load (Slippage)	
Both main riser attachment (3,4)	
Dummy (B1, B2)	
4.5	
5850	
5	
8.8	F/2 🛕 🕴 🛕 F/2
No	$\backslash \perp \mid \perp /$
Yes	\3 4/
POSITIVE) j (
	B1 B2
	F/2 V F/2
	5.5.1.1 Positive symmetric load (Slippage) Both main riser attachment (3,4) Dummy (B1, B2) 4.5 5850 5 8.8 No Yes

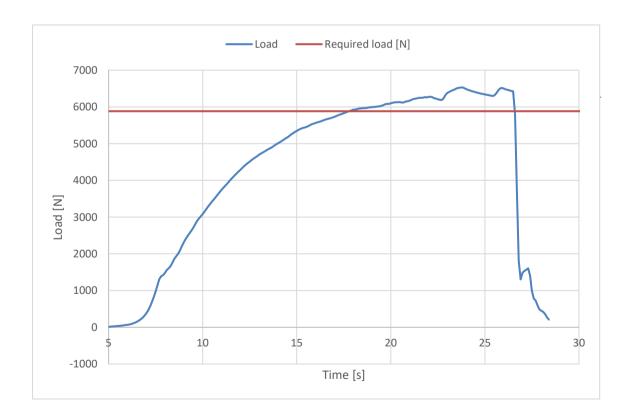


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH_294.2020 model: Submarine

Harness Structural test		Test ID 03
Standard	EN 1651	
Reference in standard	5.5.1.1b	
Test setup	Positive symmetric load	
Attachment points	Both main riser attachment (3,4)	
Anchor points	Dummy (B1, B2)	
Required load [g]	15	
Required load [N]	19500	
Minimum test duration [s]	5	
Result		
Test duration [s]	7.8	F/2 ♠ ♠ F/2
Any signs of structural failure	No	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
Slippery test OK	Yes	\3 4/
Test results	POSITIVE) j
		B1 B2
		F/2 V F/2

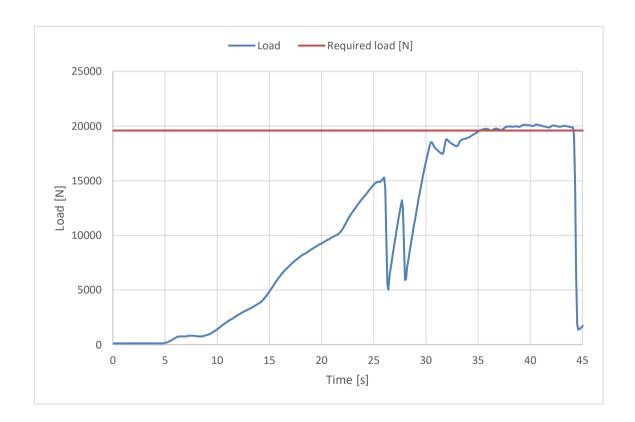


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH_294.2020 model: Submarine

Harness Structural test		Test ID 05
Standard	EN 1651	
Reference in standard	5.5.1.2	
Test setup	Positive asymmetric load	
Attachment points	One riser attachment (3 or 4)	
Anchor points	Dummy (C)	
Required load [g]	6	^
Required load [N]	7800	
Minimum test duration [s]	5	
Result		∫ F /
Test duration [s]	8.7	B1 /3 /
Any signs of structural failure	No	
Test results	POSITIVE	
		B2
		\(\frac{\cap c}{c}\)
		↓ F

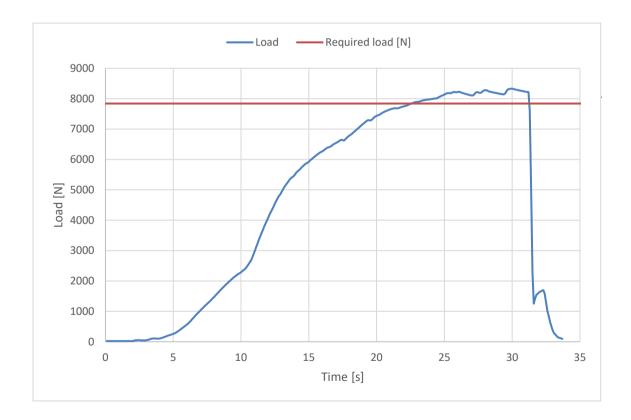


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH_294.2020 model: Submarine

Harness Structural test		Test ID 06
Standard	EN 1651	
Reference in standard	5.5.1.6	
Test setup	Negative symmetric load	
Attachment points	Both main riser attachment (3,4)	
Anchor points	Dummy (A)	
Required load [g]	6	A.F.
Required load [N]	7800	1
Minimum test duration [s]	5	
Result		
Test duration [s]	8.2	<u> </u>
Any signs of structural failure	No) į
Test results	POSITIVE	
		3 4/
) ↓ F/2
		() ()

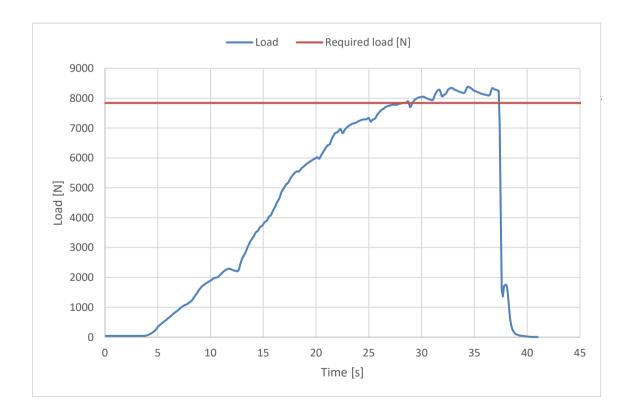


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH_294.2020 model: Submarine

Harness Structural test		Test ID 09
Standard	EN 1651	
Reference in standard	5.5.1.3	
Test setup	Positive symmetric load rescue points	S
Attachment points	Both main riser attachment (1,2)	
Anchor points	Dummy (B1,B2)	F/2 ▲
Required load [g]	15	由。 ② 包
Required load [N]	19500	
Minimum test duration [s]	5	
Result		
Test duration [s]	8.5	
Any signs of structural failure	No	
Slippery test OK	Yes	\
Test results	POSITIVE) (
		B1 B2
		F/2 \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \

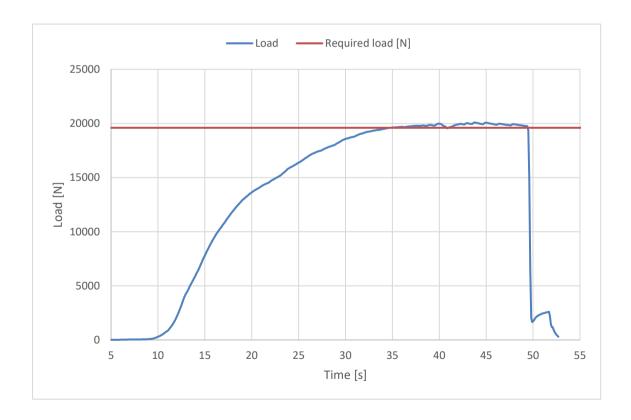


Route du Pré-au-Comte 8 🔺 CH-1844 Villeneuve 🔺 +41 (0)21 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH_294.2020 model: Submarine

Harness Structural test				Test ID 12
Standard	EN 1651			
Reference in standard	5.5.1.7			
Test setup	Upright (landing			
Attachment points	Both main riser	attachment (3,	4)	
Anchor points	Both legstrap of	harness (no d	lummy)	
Required load [g]	6			
Required load [N]	7800			
Minimum test duration [s]	5			
Harness type	type b			
Result				
Test duration [s]	10.7			
Any signs of structural failure	No			
Slippery test OK	Yes			
Test results	POSITIVE			
F/2 W F/2		F/2	F/2 F/2	
harness type a	ha	rness type b	harness type c	

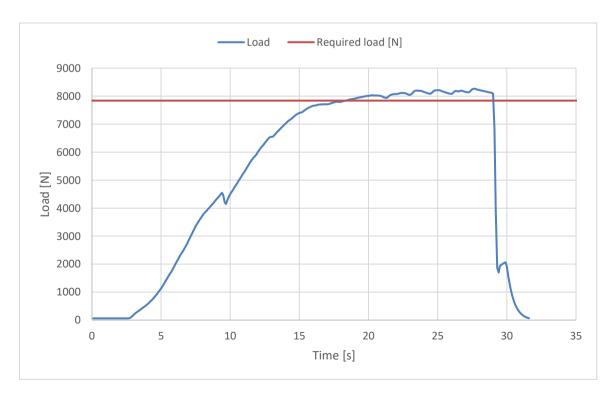

Route du Pré-au-Comte 8 ▲ CH-1844 Villeneuve ▲ +41 (0)2) 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH_294.2020 model: Submarine

Rescue Deployment Test ID RRDT

Standard LTF NfL II 91/09

Reference in standard 6.1.5

Test setup Default flying position


Attachment points Sensor connect to handle, and pull in opening direction

The test is to simulate the load required to open the emergency parachute(1st action).

Min. Required load [N] 20
Max. Required load [N] 70

Result

Load for first action [N] 44.73
Test results POSITIVE

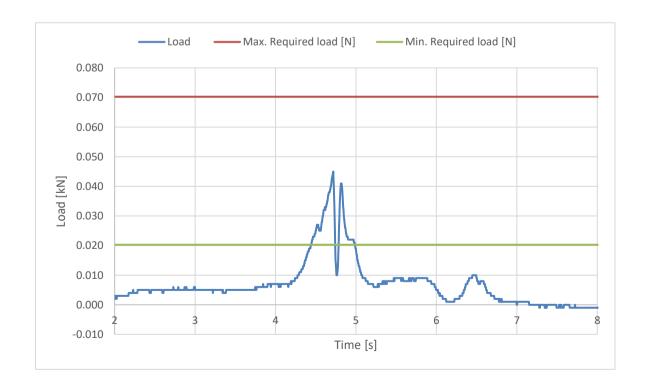

Route du Pré-au-Comte 8 ▲ CH-1844 Villeneuve ▲ +41 (0)2) 965 65 65

Test laboratory for paragliders, paraglider harnesses and paraglider reserve parachutes



Inspection certificate number: PH_294.2020 model: Submarine

Rescue Deployment Handle strength test

Test ID RRST

Standard **EN12491:2015**

Reference in standard 5.3.2

Test setup Two end points of handle


Attachment points Sensor connect to end of handle, pull on the other side

The handle must support min 700 N for 10 s, after measure breaking strength

Min. Required load [N] 700
Minimum test duration [s] 10

Result

Test duration [s]: 20.9
Breaking strength [N] 2776.22
Test results POSITIVE

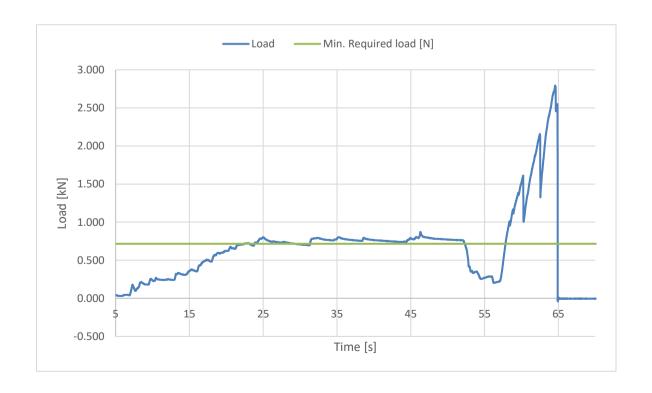

 $The \ validation \ of \ this \ test \ report \ is \ given \ by \ the \ signature \ of \ the \ test \ manager \ on \ the \ Inspection \ Certificate \ no \ 94.20$