

Harness Structural test Report - EN

Inspection certificate number: **PH_414.2023**

Manufacturer data:

Manufacturer name: **AIR MKG - Kortel Design**
 Representative: **Max Jeanpierre**
 Street: **1096 Avenue André Lasquin**
 Post code place: **74700 Sallanches**
 Country: **France**

Sample data:

Name: **Kliff 3**
 Type: **ABS**
 Size: **M**
 Serial number: **20230807**
 Impact pad type: ⁽¹⁾ **n/a**
 Clip-in weight [kg]: **120**

Date of test: **08.08.2023**

Atmosphere AGL:

[C°]	22
RH [%]	41
[hPa]	1008

Summary of Structural test

Test id	- EN 1651	Setup	Req. Load [g]	Req. Load [N]	Min. duration [s]	Result
01 ⁽³⁾	✓ 5.5.1.1	Positive symmetric load (Slippage)	4.5	5400	5	POSITIVE
03 ⁽³⁾	✓ 5.5.1.1b	Positive symmetric load	15	18000	5	POSITIVE
05	✓ 5.5.1.2	Positive asymmetric load	6	7200	5	POSITIVE
06	✓ 5.5.1.6	Negative symmetric load	6	7200	5	POSITIVE
08 ⁽⁵⁾	5.5.1.9	Anti falling-out system	4.5	5400	5	n/a
09 ⁽³⁾⁽⁴⁾	5.5.1.3	Positive symmetric load rescue points	15	18000	5	n/a
10 ⁽³⁾⁽⁴⁾	5.5.1.4	Negative symmetric load rescue points	15	18000	5	n/a
11	5.5.1.8	Connecting element for rescue	n/a	24000	0.3	n/a
12 ⁽³⁾	✓ 5.5.1.7	Upright (landing) position load	6	7200	5	POSITIVE
14	5.5.1.5	Negative symmetric load towing points	5	6000	5	n/a

Rescue deployment test

Test id	- EN 1651	Setup	Min load [N]	Max. load [N]	Measured [N]	Result
RRDT	5.5.1.11	Default flying position	20	70	0.00	n/a

Rescue Deployment Handle strength test

Test id	- EN 12491	Setup	Req. Load [N]	Min. duration [s]	Breaking strength [N]	Result
RRST	5.3.2	Two end points of handle	700	10	0.00	n/a

Manufacturer	Instrument	Type no	S/N	Validity
HBM	Load Sensor GE01	1-S9M/50KN-1	31314643	04.09.2023
Burster / MTS	Load sensor 10kN SL2	8431-6010-N000S000	593507	21.04.2026
JDC elec	Geos n°11 Skywatch	Geos n°11	Unit11	18.06.2025

Air Turquoise SA, has thoroughly tested the sample mentioned above and certifies its conformity with the following standards:

EN1651:2018+A1:2020⁽⁶⁾ and EN12491:2015+A1:2021⁽⁶⁾

The validation of this test report is given by the signature of the test manager on the Inspection Certificate no 94.20b

⁽¹⁾ If Impact pad available, see test report no. 94.22 and inspection certificate no. 94.20b. ⁽³⁾ Slipping test of any adjustable components: No slippage of any adjustable element more than 10 mm at 4500N for 5 s. The marks should be added with a pre-load of 1000N. ⁽⁴⁾ For harness with integrated Y bridle, test in the end loop ⁽⁵⁾ Attach to anti-falling out system without connecting the crotch straps (breast straps)

⁽⁶⁾ These standards are NOT covered by accreditation D-IS-19457-01

Calculated value in tests reports include the value minus the uncertainty (on safe side) / The uncertainty stated is the expanded uncertainty obtained by multiplying the standard uncertainty by the coverage factor k = 2. The value of the measurand lies within the assigned range of values with a probability of 95%

This declaration must not be reproduced in part without the written permission of AIR TURQUOISE SA

Inspection certificate number: **PH_414.2023**

model: **Kliff 3**

Harness Structural test



Test ID 01

Standard **EN 1651**
Reference in standard **5.5.1.1**
Test setup **Positive symmetric load (Slippage)**
Attachment points **Both main riser attachment (3,4)**
Anchor points **Dummy (B1, B2)**

Required load [g] **4.5**
Required load [N] **5400**
Minimum test duration [s] **5**

Result

Test duration [s] **20.6**
Any signs of structural failure **No**
Slippery test OK **Yes**
Test results **POSITIVE**

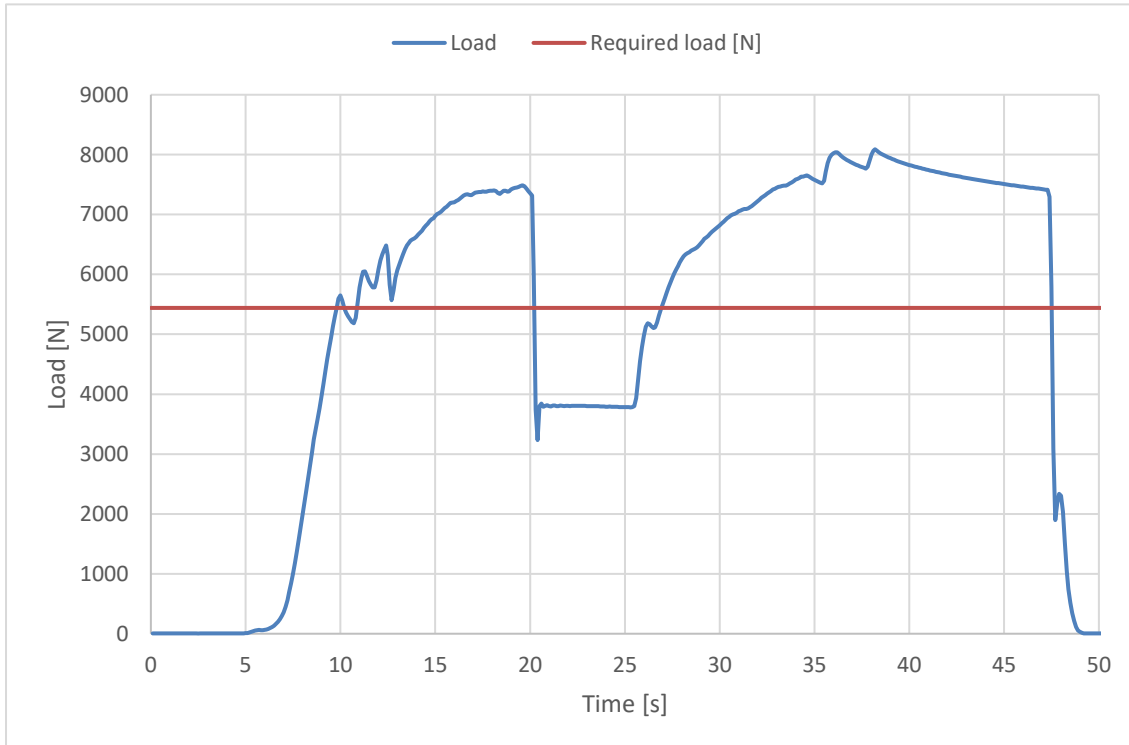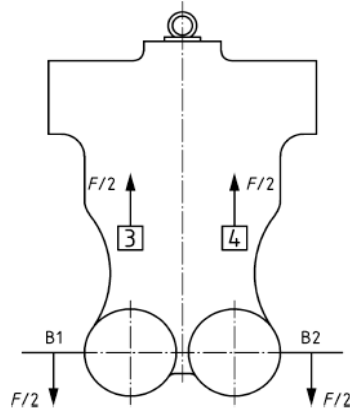

The validation of this test report is given by the signature of the test manager on the Inspection Certificate no 94.20b

Inspection certificate number: **PH_414.2023**

model: **Kliff 3**

Harness Structural test



Test ID 03

Standard **EN 1651**
Reference in standard **5.5.1.1b**
Test setup **Positive symmetric load**
Attachment points **Both main riser attachment (3,4)**
Anchor points **Dummy (B1, B2)**

Required load [g] **15**
Required load [N] **18000**
Minimum test duration [s] **5**

Result

Test duration [s] **9.2**
Any signs of structural failure **No**
Slippery test OK **Yes**
Test results **POSITIVE**

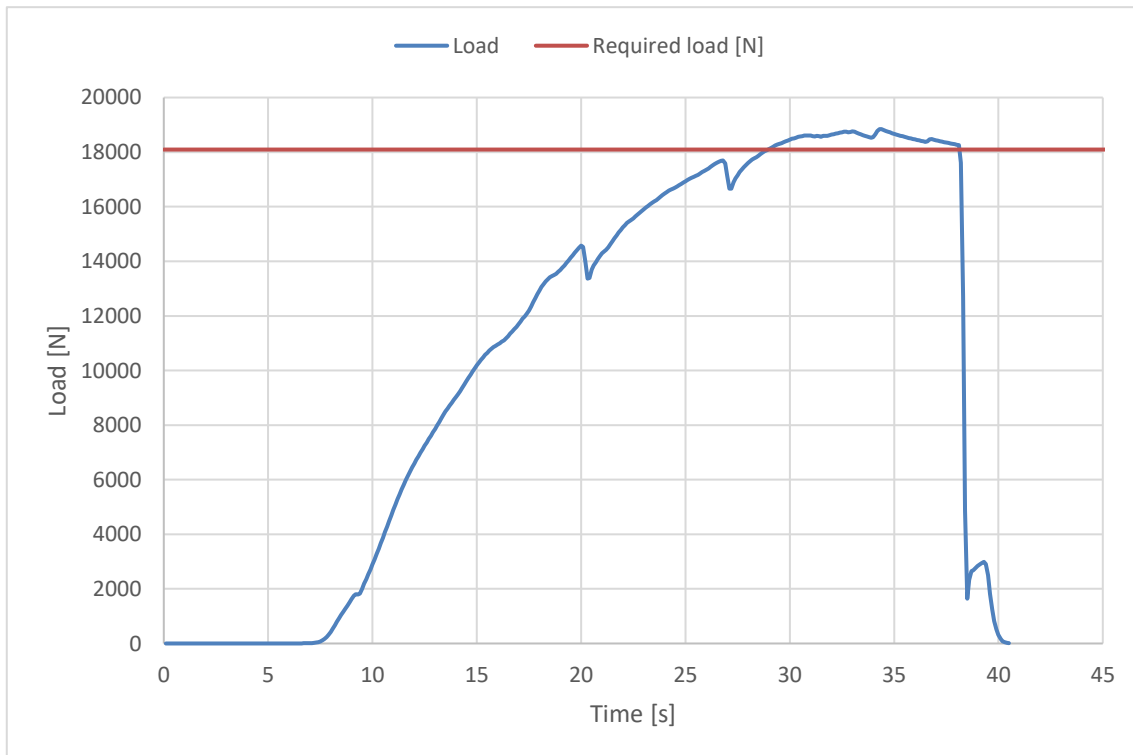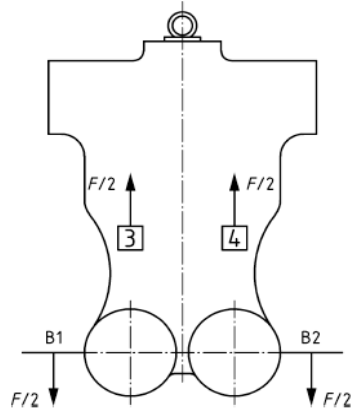

The validation of this test report is given by the signature of the test manager on the Inspection Certificate no 94.20b

Inspection certificate number: **PH_414.2023**

model: **Kliff 3**

Harness Structural test



Test ID 05

Standard **EN 1651**
Reference in standard **5.5.1.2**
Test setup **Positive asymmetric load**
Attachment points **One riser attachment (3 or 4)**
Anchor points **Dummy (C)**

Required load [g] **6**
Required load [N] **7200**
Minimum test duration [s] **5**

Result

Test duration [s] **15.5**
Any signs of structural failure **No**
Test results **POSITIVE**

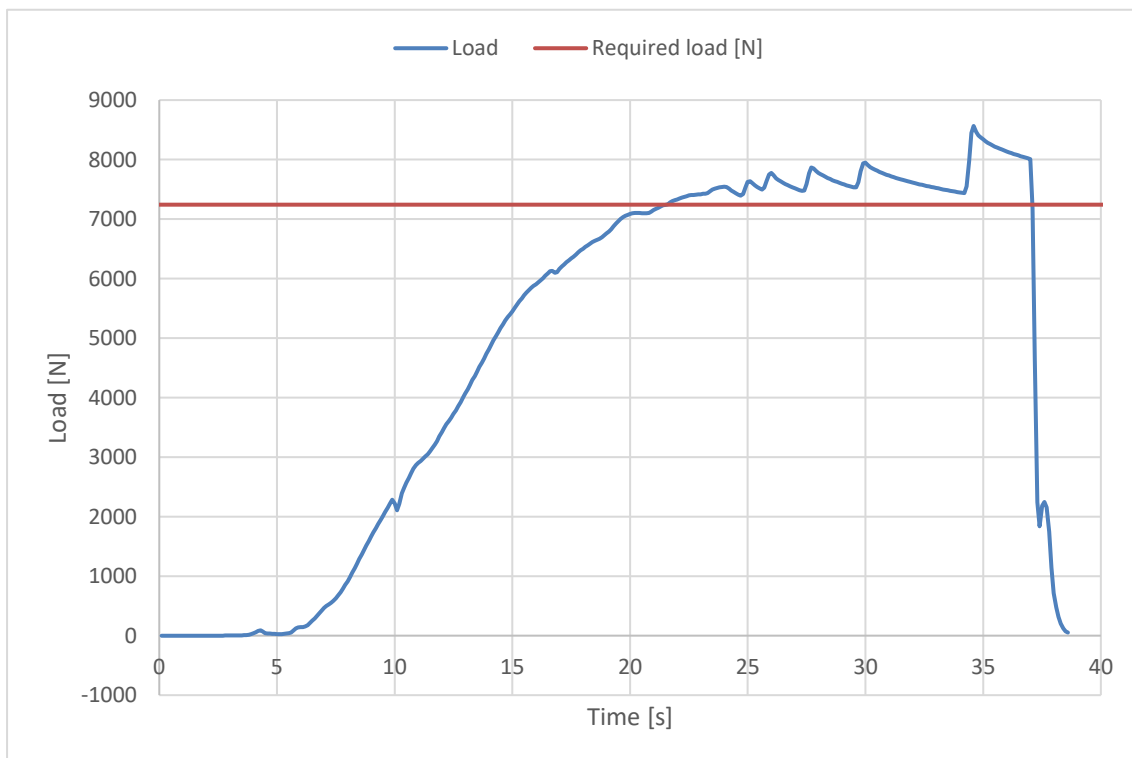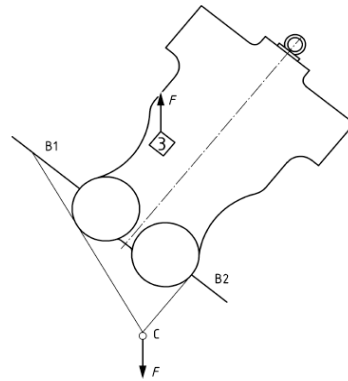

The validation of this test report is given by the signature of the test manager on the Inspection Certificate no 94.20b

Inspection certificate number: **PH_414.2023**

model: **Kliff 3**

Harness Structural test



Test ID 06

Standard **EN 1651**
Reference in standard **5.5.1.6**
Test setup **Negative symmetric load**
Attachment points **Both main riser attachment (3,4)**
Anchor points **Dummy (A)**

Required load [g] **6**
Required load [N] **7200**
Minimum test duration [s] **5**

Result

Test duration [s] **6.7**
Any signs of structural failure **No**
Test results **POSITIVE**

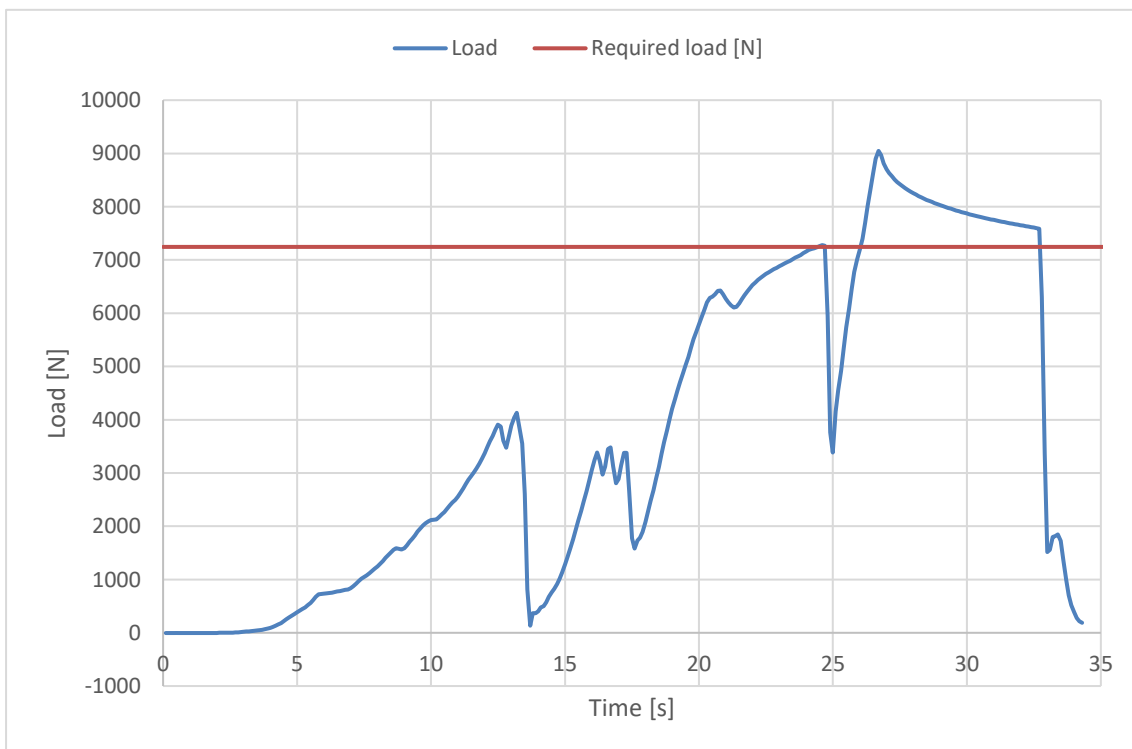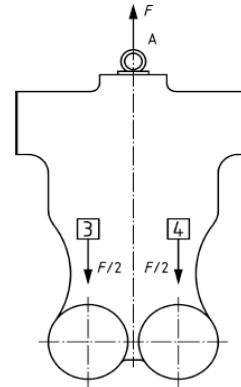

The validation of this test report is given by the signature of the test manager on the Inspection Certificate no 94.20b

Inspection certificate number: **PH_414.2023**

model: **Kliff 3**

Harness Structural test





Test ID 12

Standard **EN 1651**
Reference in standard **5.5.1.7**
Test setup **Upright (landing) position load**
Attachment points **Both main riser attachment (3, 4)**
Anchor points **Both legstrap of harness (no dummy)**

Required load [g] **6**
Required load [N] **7200**
Minimum test duration [s] **5**
Harness type **type b**

Result

Test duration [s] **9.1**
Any signs of structural failure **No**
Slippery test OK **Yes**
Test results **POSITIVE**

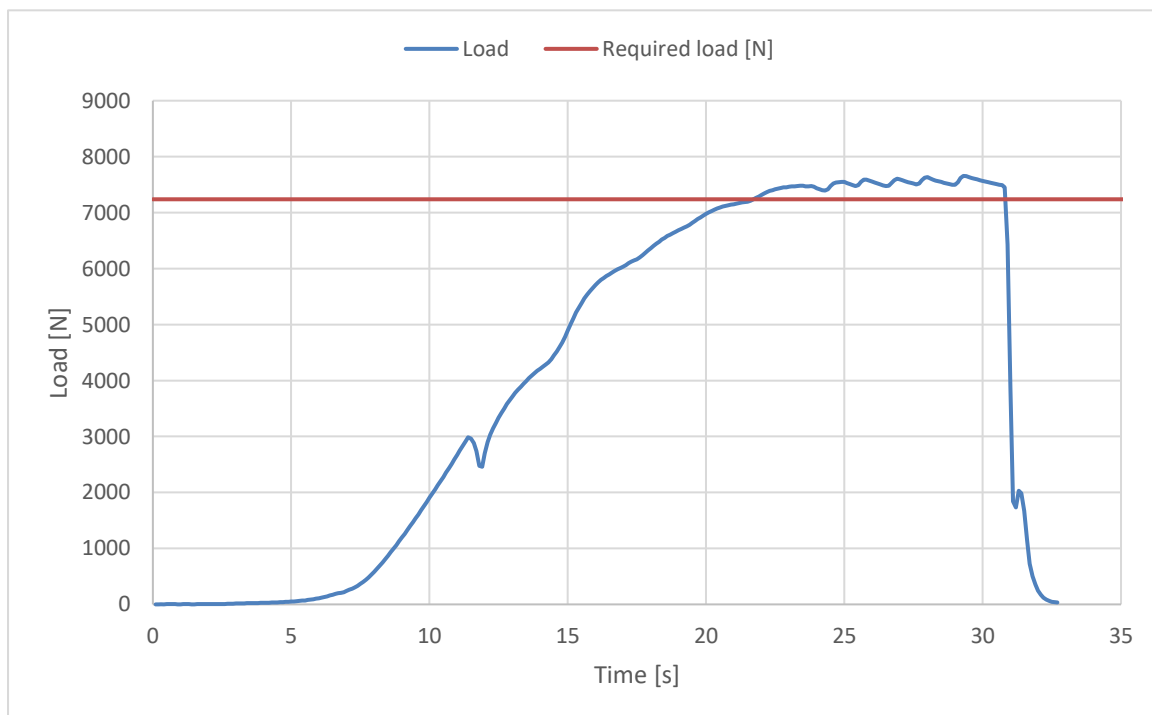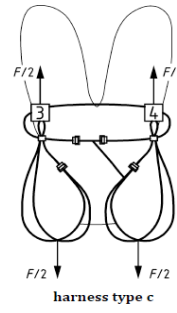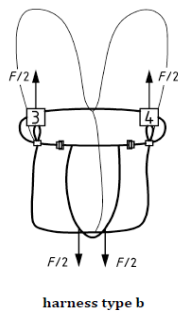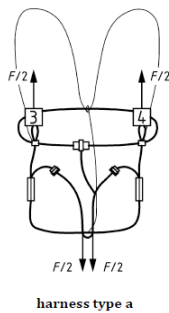

The validation of this test report is given by the signature of the test manager on the Inspection Certificate no 94.20b